

6N21L-N PISTON (RECONDITIONED)

MAKER	YANMAR	ENGINE MODEL	6N21L-N
DESCRIPTION	PISTON ASSY (RECONDITION)	PARTS NO.	147673-22453-C
INSPECTION NO.	M460		


GAUGE NO. NO. 10721
DIAL GAUGE NO. U19628


Clearance After Recondition.

1 — 4.5mm + 0.070 ~ + 0.095

2 — 4.5mm + 0.045 ~ + 0.070

3 — 8mm + 0.020 ~ + 0.035

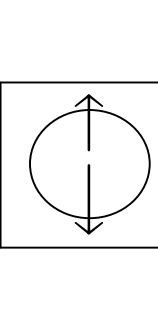

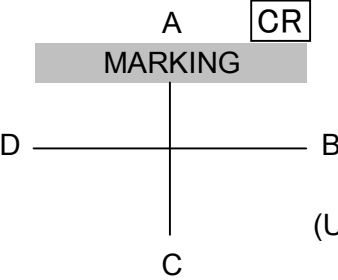

(Unit mm)

Cr Plating Ring grooves.
Remarks : Defric Coat Finishing.

※ Do not use the 3-face Cr-plated top ring.
Be sure to use the item for piston ring groove repaired plating (No. 147676-22950).

INSPECTION RECORDS M460

	A	B	C	D
1	4.581	4.581	4.586	4.587
2	4.562	4.563	4.562	4.562
3	4.59	4.58	4.59	4.58
4	8.05	8.05	8.05	8.06